NON-ISOTHERMAL KINETIC STUDY ON THE DEHYDRATION OF MECHANICALLY ACTIVATED ALUNITE

Furkan KÜÇÜK¹, Kenan YILDIZ²

¹ Kortek Ltd.Şti., İstanbul ² Sakarya Üniv., Müh.Fak., Metalurji ve Malz. Müh., Adapazarı. Tel:264 2955770, kenyil@sakarya.edu.tr

ABSTRACT

In this study, alunite ore was activated mechanically in an attritor for 15 min and then thermal analysis was carried out on both non-activated and activated alunite in different heating rates. Using of thermogravimetry data, the dehydration kinetics of alunite was studying with KAS (Kissenger-Akahira-Sunose) equation. The effect of mechanical activation on the dehydration kinetics of alunite and its thermal behaviour were investigated.

Keywords - alunite, dehydration, mechanical activation, non-isothermal kinetic

MEKANİK AKTİVE EDİLMİŞ ALUNİTİN DEHİDRATASYONU ÜZERİNE İZOTERMAL OLMAYAN KİNETİK ÇALIŞMASI

ÖZET

Bu çalışmada, alunit cevheri bir atritörde 15 dakika süreyle aktive edilmiş, daha sonra farklı ısıtma hızlarında hem aktive edilmemiş hem de aktive edilmiş alunitin termal analizleri alınmıştır. Termogravimetrik data kullanılarak, alunitin dehidratasyon kinetiği KAS (Kissenger-Akahira-Sunose) denklemiyle incelenmiştir. Alunitin dehidratasyon kinetiği ve termal davranışı üzerine mekanik aktivasyonun etkisi araştırılmıştır.

Anahtar Kelimeler - Alunit, dehidratasyon, mekanik aktivasyon, izotermal olmayan kinetik

1. INTRODUCTION

Alunite is one of the minerals of the jarosite group. It is a potassium-alum occuring generally in rhombohedral and hexagonal crystals. Its chemical formula is KAI₃(SO₄)₂(OH)₆, and as a source of alum, potassium and aluminum, it is a commercial raw material for the chemical industry. In Turkey, alunite reserves are located in Şebinkarahisar-Giresun (15-20 million tons), Şaphane-Kütahya (7 million tons) and Foça-Izmir (5 million tons) regions [1-3].

The structure of alunite contains aluminium sulphate and potassium sulphate, both of them dissolve in water.

However, alunite does not dissolve in water, acids and bases unless calcined. Alunite calcined at temperatures over 500°C dissolves due to the decomposition of the structure. It is widely used in the manufacturing of aluminium sulphate, potassium alum, alumina and potassium sulphate. The ore calcined at 600-650°C is converted to the above mentioned products by acidic and basic extractions. At one of the production method of alumina from alunite, the ore is calcined at 600-650°C and extracted with sulphuric acid. After leaching the solid part is calcined. This calcine is extracted with hot water to remove the soluble potassium sulphate. The remaining solid is obtained as alumina [4,5].

The mechanical activation of minerals makes it possible to reduce their decomposition temperature or causes such a degree of disordering. The mineral activation leads to a positive influence on the leaching reaction kinetics and to an increase in the measured surface area [6]. Mechanical activation of minerals by intensive grinding is a non-traditional way of influencing the processes in extractive metallurgy. Creation of fine particles, increase in specific surface area and formation of defective structures are among the main factors which accelerate leaching in hydrometallurgy. Some special regimes of grinding cause not only the physico-chemical transformations but also the changes in the chemical compositions of the activated minerals [7].

In this study, non-isothermal kinetic study on the dehydration of both non-activated and activated alunite was investigated.

2. MATERIAL AND METHOD

2.1 Material

Aluminum Sulphate Ltd. in Şaphane-Kütahya, Turkey. It was crushed and ground and sieved to -100 µm size. The chemicals used in the extraction study and in the analysis were obtained from Merck Chemical Co. The chemical analysis of alumite ore is 22.98% Al₂O₃, 4.66% K₂O₄, 45.56% SiO₂, 18.03% SO₃, 0.61% Fe₂O₃, 0.16% CaO+MgO and 8.00% H₂O [8].

2.2 Experimental Procedure

Mechanical activation of alunite ore was performed in an attritor (stirring ball mill) under following conditions: weight of the sample: 10 g, weight of balls: 200 g of stainless steel balls with 5.5 mm in diameter, grinding time: 0 and 15 min, stirring rate: 850 rpm.

X-ray diffraction analysis were performed using a Rigaku Ultima X-ray diffractometer and Cu Ka radiation was used (40 kV, 30 mA). Thermal analysis studies (TG and DTA) was performed using Netzsch RT-1500C TGA/DTA apparatus at different (5°, 10°, 15° and 20 °C/min) heating rates.

2.3. Kinetic Study by Thermogravimetry

Dehydration of solids is the subject of many kinetic studies. It helps to understand the following decomposition mechanism: $A(s) \rightarrow B(s) + C(g)$.

This is a model-free method, which involves measuring temperatures corresponding to fixed values of α freexperiments at different heating rates (β). The activatenergies (Ε) can be calculated according to isoconvertional methods of KAS (Kissenger-Akahi Sunose), Friedman and Ozawa [9]. In kinetic study of broon-activated and activated alunite, KAS equation was us to determine the activation energy of the dehydrat reactions.

The kinetic model of dehydration that occurs in a isothermal conditions is described by KAS eq. (1).

$$\ln\left(\frac{\beta}{T^2}\right) = \ln\left[\frac{\Delta E}{Rg(\alpha)}\right] - \left(\frac{E}{RT}\right) \tag{1}$$

where α is the degree of conversion, β is the heating rate K.min. A is the pre-exponential factor in min. I temperature in K, R is the gas constant, E is activate energy in kJ.mol. and $g(\alpha)$ is the integral form of the favireh is the reaction model.

According to the above mentioned equation, the plot $\ln(\beta/T^2)$ versus 1000/T correspoding to different conversions α can be obtained by a linear regress of a square method. The activation energy (E) can be calculated from the slope of every line with better linear correlation coefficient (r) [9.10].

This method is used to calculate the activation energy of process without its kinetic mechanism.

3. RESULTS AND DISCUSSION

3.1. X-Ray Diffraction Analysis

The X-ray diffraction analysis of non-activated activated alunite ore is given in Figure 1. Considering peaks of non-activated and activated alunite, it can clearly seen that all diffraction peaks of alunite get shoufter mechanical activation. This is due to the startin amorphisation in alunite structure. In literature[6,7,1] was reported that the mechanical activation resulted in amorphisation of mineral particles. The peaks of Si0 not affected with mechanical activation because o strong structure.

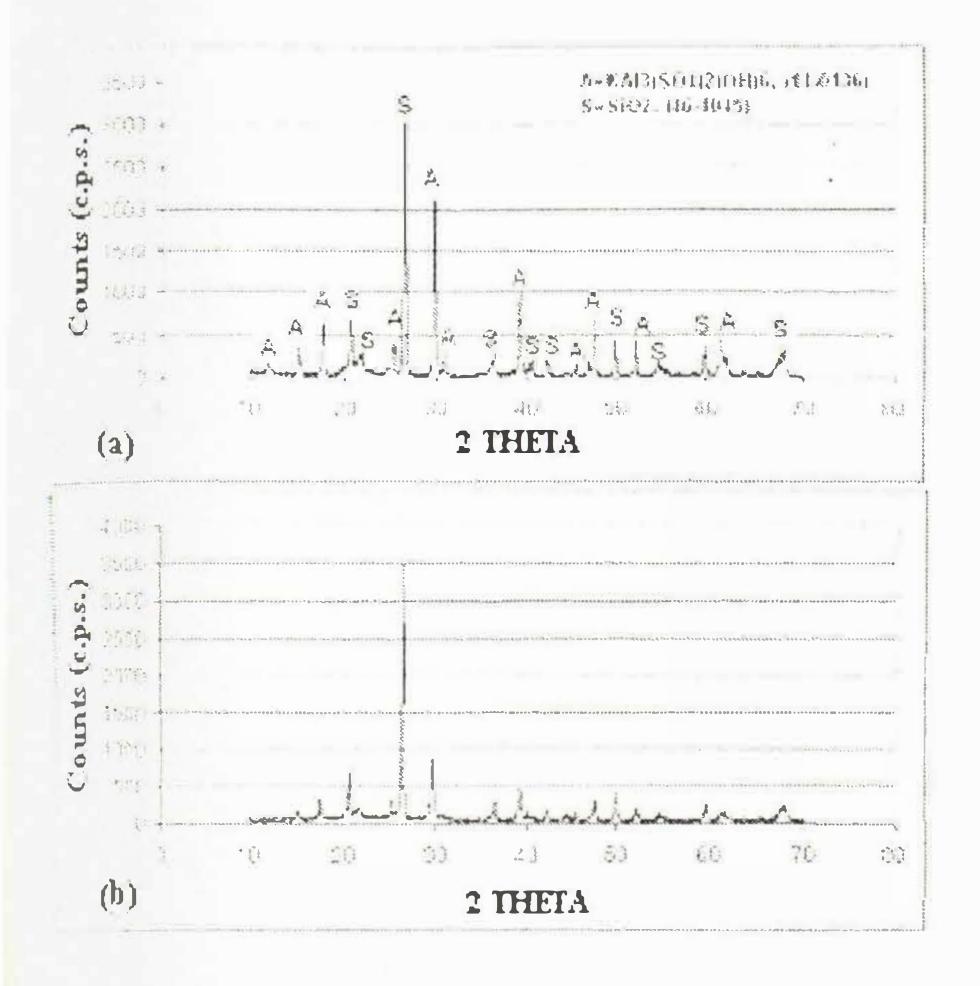


Figure 1. X-ray diffraction patterns of (a) non-activated alumite and (b) activated alumite

3.2. Thermal Decomposition of Non-activated and Activated Alumite

The thermal analysis (TG and DTA) of non-activated and mechanically activated alunite ore is given in Figure 2. The DTA curves for both alunite ores show two endothermic peak and one small exothermic peak. The first endothermic peaks at about 560° C for non-activated and 545° C for activated alunite ores are strong and sharp. This is due to the dehydration of the structural water and the transformation of alunite into KAl(SO₄)₂ and amorphous Al₂O₃, as given in Eq. (2),

$$KAl_3(SO_4)_2(OH)_6 \rightarrow KAl(SO_4)_2 + Al_2O_3 + 3H_2O_{(2)}$$

The exothermic peaks at about 787°C for both alunite ore appear immediately before the second endothermic peak at about 820°C for non-activated alunite ore and 810°C for activated alunite ore.

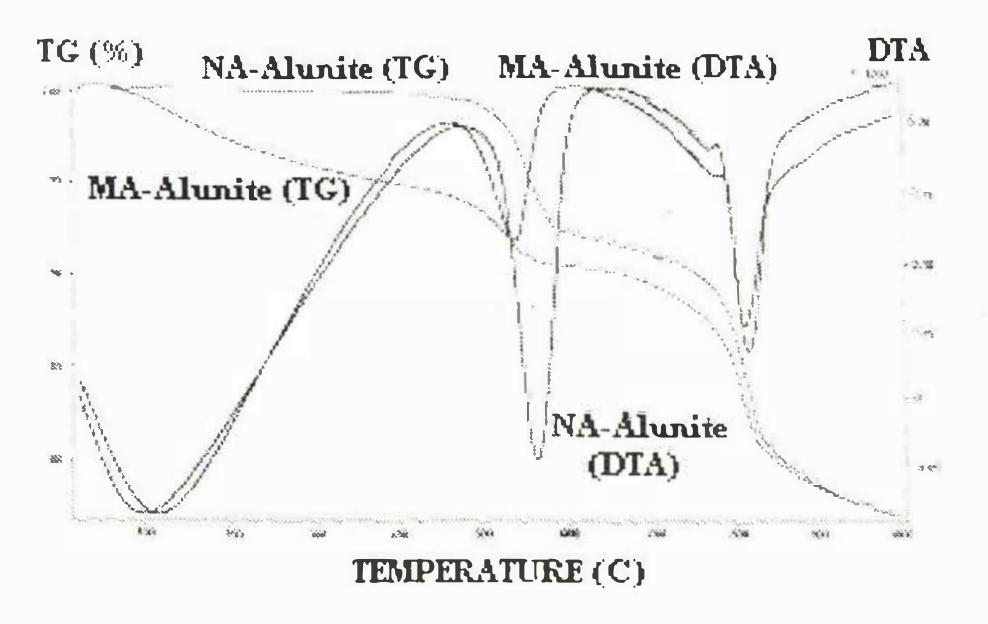


Figure 2. Thermal analysis (TG and DTA) of non-activated (NA-alumite) and activated alumite (MA-Alumite)

It was stated [4] that this small exothermic peak at about 787° C was probably caused by the recrystallization of $KAl(SO_4)_2$ into $K_3Al(SO_4)_3$ and $Al_2(SO_4)_3$, as given in Eq. (3).

$$2KAI(SO_4)_2 \rightarrow \frac{2}{3}K_3AI(SO_4)_3 + \frac{2}{3}AI_2(SO_4)_3$$
 (3)

The second endothermic peak at 820°C for non-activated alunite ore is due to the desulphation by which $K_3Al(SO_4)_3$ and $Al_2(SO_4)_3$ decompose into K_2SO_4 and Al_2O_3 , as given in Eq. (4) and Eq. (5),

$$\frac{2}{3}$$
 K₃Al(SO₄)₃ \rightarrow K₂SO₄ + $\frac{1}{3}$ Al₂(SO₄)₃ (4)

$$\frac{2}{3}$$
 Al₂(SO₄)₃ $\rightarrow \frac{2}{3}$ Al₂O₃ + 2SO₂ + O₂ (5)

The TG curve for non-activated alunite ore shows two steps of weight losses corresponding to the two endothermic peaks. The weight losses are about 8% for the first endotherm (dehydration) and about 22% as the total weight loss after the second endotherm (desulphation). On the contrary, the dehydration of mechanically activated alunite ore is started from 100°C. This is result of amorphisation and structural disordering, providing with mechanical activation. The weight loss up to 650°C is about 8% for activated alunite ore. The mechanical activation affected importantly on dehydration behaviour of alunite ore.

The dehydration temperature decreases about 15°C in mechanically activated alunite ore. The most important point about the dehydration of mechanically activated alunite is its starting from 100°C, due to amorphisation and structural disordering in alunite. In a previous study[11] it was investigated the effect of time of mechanical activation on the thermal decomposition of alunite ore and it was observed that 15 min of mechanical activation is enough to active the alunite ore.

3.3. Non-isothermal Kinetic Study

For the dehydration kinetic study of non-activated and activated alunite, their TG datas were used in non-isothermal conditions. The dehydration part of non-activated alunite is given in Figure 3 and that of activated alunite in Figure 4. According to TG data, α (degree of conversion or ratio of dehydration) and related temperature values (K) were listed in Table 1.

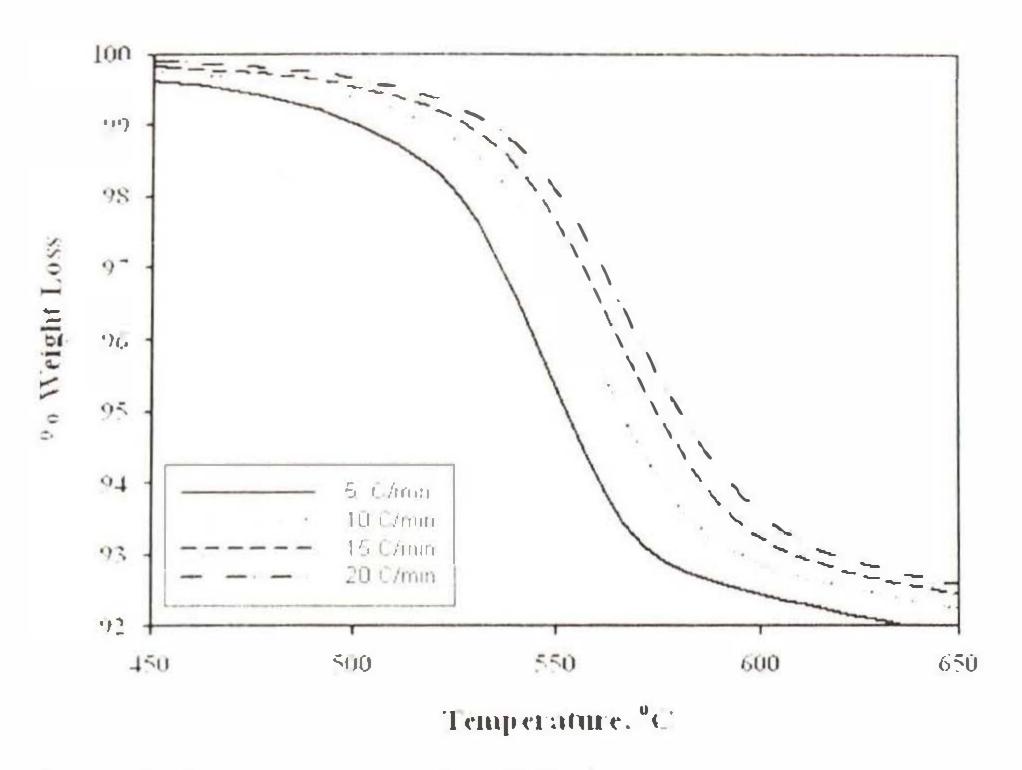


Figure 3. TG curve of non-activated alumite

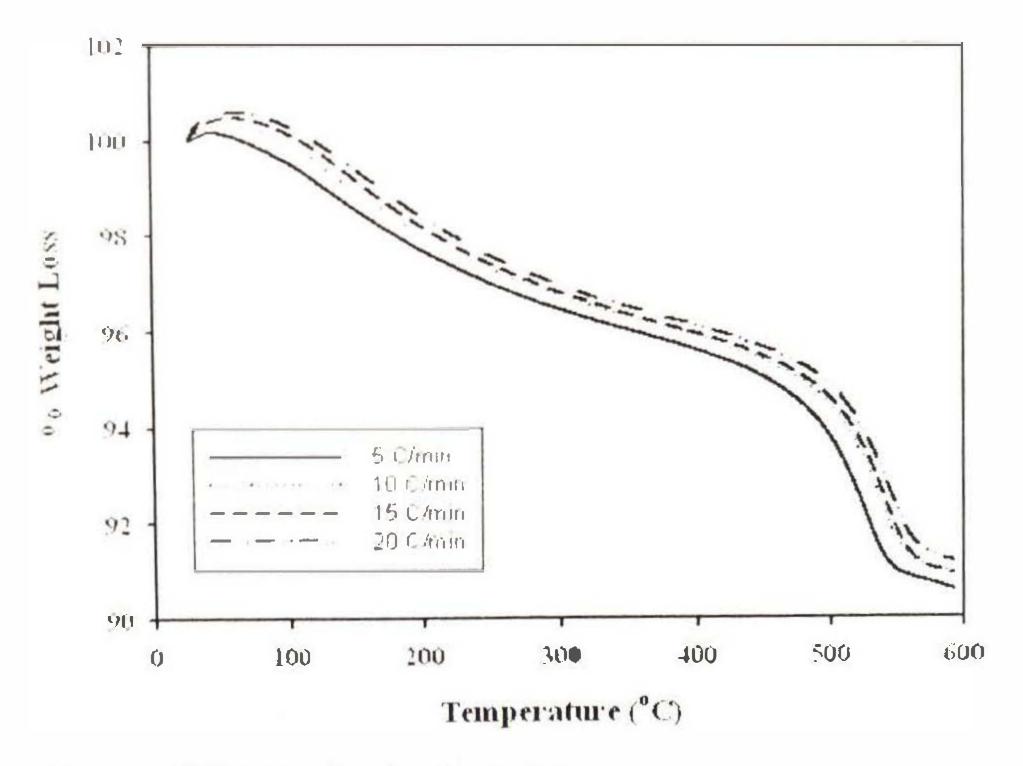


Figure 4. TG curve of activated alunite

According to the equation(1), the plots of $\ln(\beta/T^2)$ versus 1000/T correspoding to different conversions α are given in Figure 5 for non-activated alunite and in Figure 6 for activated alunite. The activation energies (E) were calculated from the slope of every line and regression coefficients were listed in Table 2.

As seen from Table 2, the activation energy values devication reaction of non-activated alumite are varying between 173.5 and 303.9 kJ/mol, corresponding to differe conversions. These values for activated alumite are varying between 41.16 and 278.29 kJ/mol. In literature, such relationship between activation energy and degree conversion was stated [12,13]. It can be said that the activation energy of dehydration reaction of non-activate alumite is about 280-300 kJ/mol.

On the contrary, the activation energy values are varying wide ranges. The comparison of the activation energy values for non-activated and activated alunite is given Figure 7.

Table 1. a and T(K) values for different heating rates.

	Temperature (K)									
(X	Non-activated alumite				Activated alumte					
	14	eating rat	e(β. K/mi	Heating rate(ß, K mm)						
	5	10	15	20	5	10	15	20		
(), [764.6	785.2	796.1	801.6	393.6	413.6	424.2	435.3		
0.2	792.6	806,8	814.2	819.3	442.0	456.1	466.0	477.9		
0.3	804.5	817.1	824.1	828.7	488.6	511.1	518.7	531.3		
() 4	811.9	824.5	831.7	836,4	556.9	587.8	594.3	610.7		
0.5	818.1	831,1	838.6	843.5	652.1	691,1	694.3	713.4		
0.6	823.9	837.4	845.5	851.1	731.1	754.4	760 1	771.1		
0.7	830.1	844.5	853.8	860.2	766.3	783.7	788.2	7949		
0.8	842.6	853.9	864.9	872.6	784.7	800.1	803.9	809.9		

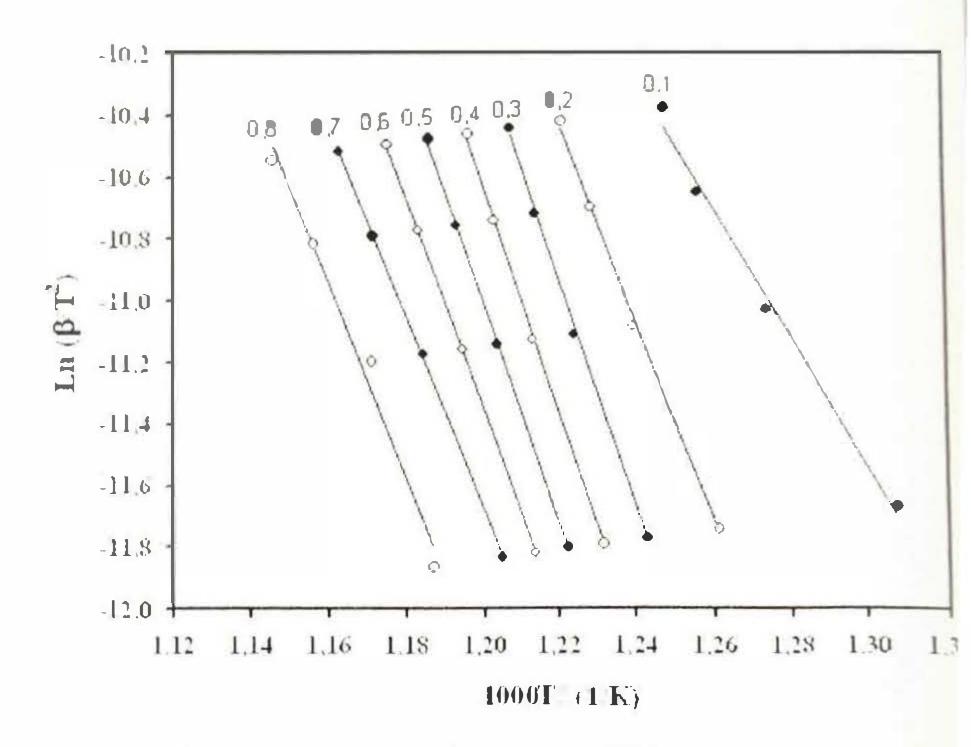


Figure 5. The plots of $\ln(\beta/T^2)$ versus 1000/T corresponding to different conversions α for non-activated alumite

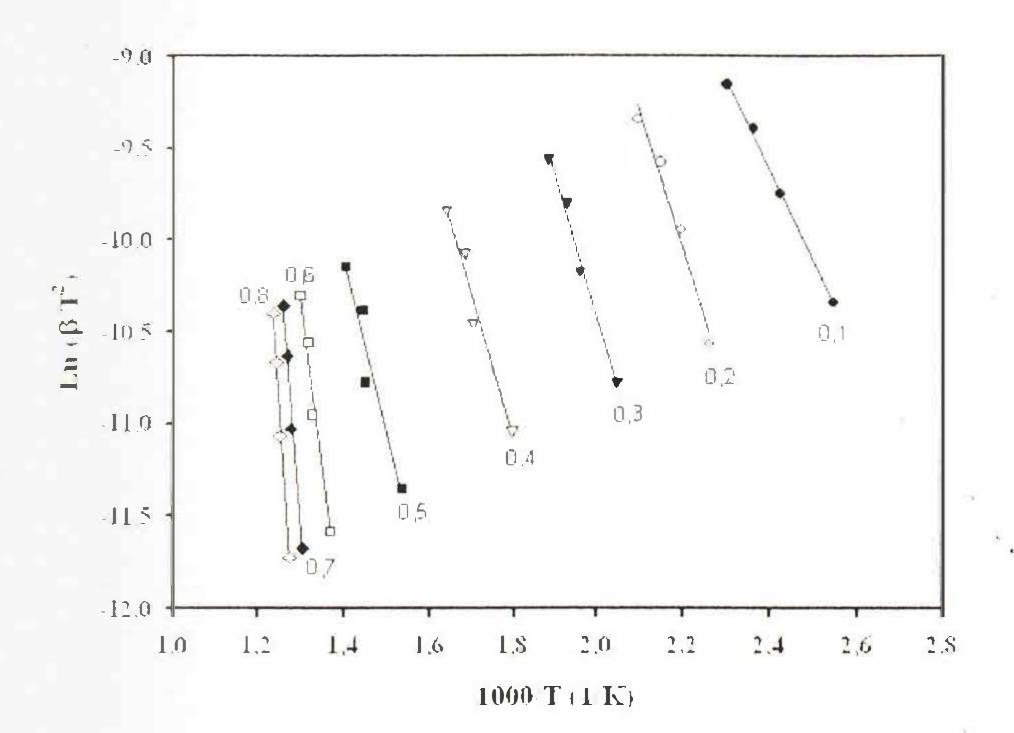


Figure 6. The plots of $\ln(\beta/T^2)$ versus 1000/T corresponding to different conversions α for activated alumite

Table 2. Activation energies (E) and r values for non-activated and activated alumite

	Non-activat	ted alunite	Activated alunite		
11	E (kJ/mol)	r	E (kJ/mol)	r	
11	173.5	().9916	41.16	().9971	
() 2	267.8	0.9982	61.09	0.9781	
() 3	302.1	0.9988	63.17	0.9845	
(), 4	3()3.9	().9992	64.41	().9648	
0.5	297.6	(),9993	76.10	0.9301	
(16	282.6	(),9999	152.24	0.9755	
() 7	258.8	(),9997	233.06	().9769	
08	264.3	0.9828	278.29	0.9758	

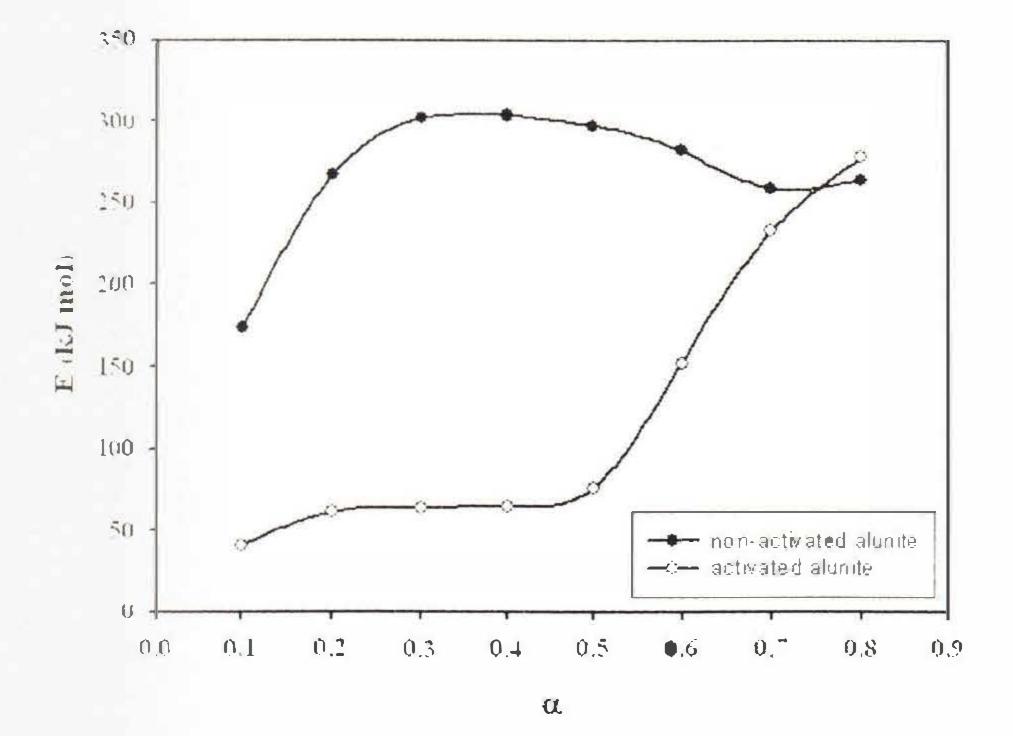


Figure 7. Comparison of activation energies calculated by KAS equation for non-activated and activated alumite

As seen in Figure 7, the activation energy values are in the range of 41 and 76 kJ/mol, up to 0.5 of α . After α =0.5, this value was increased sharply to about 278 kJ/mol. The lower activation energy values of dehydration of activated alunite, up to α =0.5, than that of non-activated alunite is due to amorphization and structural deformation in alunite during the mechanical activation process. It was observed with x-ray diffraction analysis that there was no 100% of amorphization in structure, therefore the activation energy value increased to about 278 kJ/mol.

4. CONCLUSIONS

It was determined with x-ray diffraction analysis that the alunite structure was partially amorphized by mechanical activation.

Mechanical activation affected on temperature range of dehydration reaction of alunite. This reaction occured after 100°C for activated alunite, while it was occured after 450°C for non-activated alunite. This behaviour was supported with TG and DTA.

The dehydration kinetics of non-activated and activated alunite was investigated by non-isothermal method, without kinetic mechanism. The activation energy values of dehydration of non-activated alunite were calculated between 173 and 264 kJ/mol by using of KAS (Kissenger-Akahira-Sunose) kinetic equation. The mechanical activation promoted some amorphization, but not completely, and structural disorders in alunite. This pretreatment decreased the activation energy values to the range of 41-76 kJ/mol, due to amorphization, up to α (degree of conversion)=0.5 and then activation energy was increased to actual values so that there was no 100% amorphization in alunite structure.

REFERENCES

- [1]. Gülensoy, H., The study of Turkish alunite by thermogravimetric and microcalorimetric methods and determination of solubilities of pyrolsis products in water and sulphuric acid (in Turkish) MTA Enstitüsü Dergisi, 71, 93-128,1968
- [2]. Gülensoy, H., Şengil, İ.A., *The occurences and reserves of alumite ore* (in Turkish), Kimya ve Sanayii Dergisi, 31(157-158), 116-131, 1989.
- [3]. Özacar, M., Şengil, İ.A., Optimum conditions for leaching calcined alunite ore in strong NaOH, Can. Metallurgical Quarterly, 38(4),249-255, 1999
- [4]. Küçük, A., Gülaboğlu, M.Ş., Thermal decomposition of Şaphane alunite ore, Ind.Eng.Chem.Res., 41, 6028-6032, 2002

- [5].Şengil, İ.A., Thermal decomposition of Şaphane alunite-potassium, sodium, barium or calcium chloride mixtures. Turk.J.Eng. Environ. Sci., 15, 436-446,1991
- [6].Balaz, P., Extractive Metallurgy of Activated Minerals, Elsevier Science B.V., Amsterdam, The Netherlands, 2000.
- [7].Balaz, P., Boldizarova, E., Achimovicova, M., Kammel, R., Leaching and dissolution of a pentlandite concentrate pretreated by mechanical activation, Hydrometallurgy, 57(1), 85-96, 2000
- [8].Küçük, F., Mekanik aktive edilmiş alunitin termal dekompozisyon kinetiğinin termogravimetri ile incelenmesi, Yüksek Lisans Tezi, Fen Bil.Ens., Sakarya Üniversitesi, Aralık 2005.
- [9].M.E. Brown, Introduction to Thermal Analysis-Techniques and Applications, 2nd Ed., Kluwer Academic Pub., NJ, USA, 2001

- [10]. R.R. Keuleers, J.F. Janssens, H.O. Dessey Comparison of some methods for activation energetermination of thermal decomposition reaction by thermogravimetry, Thermochimica Acta, 38 127-142, 2000
- [11]. K.Yıldız, Z.Arslanoğlu, H.Ö.Toplan, Therm decomposition of mechanically activated alumite (Turkish), 12th Int. Metallurgy-Material Congreand Fair, Istanbul, Turkey, Sept.28-Oct. 2/2005
- [12]. L.H. Yue, D.L. Jin, Z.D. Xu, The non-isothern kinetic analysis of thermal decomposition $Mg(OH)_2$, Acta Phys. Chim. Sin., 21(7),75,757,2005
- [13]. A.Khawam, D.R. Flanagan, Role of isoconversion methods in varying activation energies of so state kinetics. I-Isothermal kinetic studio. Thermochimica Acta, 429, 93-102, 2005